ANCASTER MEADOW

ANCASTER WILADOW							
Equipment	Model/Serial	Location	What it Serve	Time Spent	Filters	Belts	Repairs Needed or Repaired
	EngAir				(3of) 16x20x2 - Pleated	(1of) B72	
AHU 1	LM8C / M13882-AHU1		Various Areas	45 min	(3of) 20x20x2 - Pleated	(1of) B68	Needs new Belts - Bearings Greased - Completed
	EngAir				(15of) 20x24x2 - Pleated	(2of) B85	
HRV-1	FWB313C0 / M13882 HRV1		Gym	45 min	(3of) 24x24x2 - Pleated	(2of) BX85	Needs new Belts - Bearings Greased - Completed
	EngAir					(1of) A43	
RTU 1	FWA52CO / M13882 RTU 1		Main Offices	45 min	(1of) 24x24x2 - Pleated	(1of) A35	Belts need to be replaced - Completed
	EngAir				(1of) 12x24x2 - Pleated		
RTU 2	FWEA62CO / M13882 RTU2			45 min	(1of) 24x24x2 - Pleated	(1of) A39	Needs new Belts - Bearings Greased - Completed
	ChangeAir						
AHU	CAE1000APA VPD / 1804 1055F	Room 103		30 min	Washable		Electric Heat contactor needs replacing 2 pole 24v coil - Completed
	Changeair						
AHU	CAE100A PA VPD / 1798 1055F	Room 104		30 min	Washable		
	Changeair						
AHU	CAE1000A PA VPD / 1806 1045f	Room 102		30 min	Washable		Heating contactor pitted - Completed
	Changeair						
AHU	CAE 1000A PA VPD / 1799 1055f	Room 101		30 min	Washable		
	Changeair						
AHU	CAE 4036 PA ERWE / 1308 1118E	Room 107		30 min	(2of) 18x18x2 - Pleated		
	BAC						
Cooling Tower	VFL 072 220 / UO41276801	High Roof				(3of) B144	
	EngAir					(5of) B111	
MUA	FWA285-DG180-0 / 37116 HRU					(2of) B99	
	Greenheck						Attempted to wash economizer filters too fragile s/b replaced (Controlled by wall mounted switch which was off
Supply Air Fan	RSF 150 4 / OSB00527	Mechanical Room			(8of) 16x20x1	(1of) 3L620	and s/b on all the time or at least interlocked with Boler so as to not pull combustion air from hallway) - Completed
	Greenheck						
Exhaust Fan 6	6B 084 4 / 05B03375	Cloest to MUA				(1of) 3L180	Needs new Belts & Bearings (2of) - Completed
	Greenheck						
Exhaust Fan 2	6B 081 4 / 05BO3373	Closet to roof edge				(1of) 3L180	Belt needs to be replaced - Completed
	Greenheck					,	
Exhaust Fan 7	6B 141 3 / 05B3500	Closet to roof edge				(1of) 3K210	Belt needs to be replaced - Completed
	Changeair						
AHU	CAE 1000A PA VP F / 2422 0267C	Portable 132 (left)				(2of) 16x20x1	
	Changeair	` ,					
AHU	CAE 1000A PA VP F / 2388 0267C	Portable 078 (centre)				(2of) 16x20x1	
	Changeair	,				,	
AHU	CAE 1000A PA VP F / 23890 0267C	Portable 075 (right)				(2of) 16x20x1	
	Trane	- (0 -/				,	Gas pipe needs repainting - compressor contactor contas pitted and carboned up s/b replaced (3phase 20hp
RTU 1	YSC072A3RLA1GD0B0000A000 / 445100996L	Lower Roof	Daycare		(4of) 16x25x2	(1of0 AX32	contactor)
	Trane	=5			(: 3./ 2 0 2	1,20.0.0.02	
DTIL 2	YSR036A3LRA1DDB00000A0000 / 445100852L				(2of) 20x25x2	(1 of) AV22	Gas nine needs to be renainted
RTU 2	Greenheck				(201) 2032332	(1of) AX32	Gas pipe needs to be repainted
Evhaust Fan 3	6B0814 / 05B03374					/1 of\ 21 210	
Exhaust Fan 3 Administrative 3				1	1	(1of) 3L210	

Administrative 30 min