

SCHOOL: CHEDOKE - 500 BENDAMERE AVENUE  
 JOB: TMR-1749-03

UNIT TYPE AND TAG	MODEL	SERIAL	BELT	FILTER	UNIT LOCATION	SERVES	TIME TO COMPLETE	REQUIRES IMMEDIATE ATTENTION	NOTES
HRV	HRV2000E EDA1XG12DNHDBS	6K8220030901484	B36 & B39	4-12x24x4					
			1-B36						
HRV	HRV2000E EDA1XG12DNHDBS	6K8220030801449	1-B39	4-12x24x4					
RTU	50TFF007-511RQ	3403G50149	A39	(2) 16X25X2					
RTU	48TFF012-A-511RQ	5103G20612	A51	4-20x20x2					
RTU	50TFF007-511RQ	3403G50150	A39	(2)16X25X2					
RTU	48TFF006-A-511RQ	3203G30128	A40	(2)16X25X2				Unit will not bring on mech cooling due to economizer issue.	
EF G2	G-143-VG-7-X	12564936 1108	Direct Drive					Found unit not running, found unit off at switch. Turned switch on found power at motor but not working. Replacement motor required.	
RTU 2	FWA285/DJE60/0	M14198	B68	(4)20X20X2				Unit was tripped at the blower contactor. Reset found normal operation. If it happens again follow up will be required	
EF W2	Gg-143-VG-7-X	12564938 1108	Direct Drive						
RTU1	FWEA163/DJE40/0	M14198	4L450	2-24x24x2				: unit was is leaking water through the inside, blew out drain will monitor throughout the day. Follow up required to silicone electrical hole in blower compartment	Caretaker has requested an extension be put on the nipples of the motor for easier access for greasing bearings
EF-W3,W4	G-060-D-X	12564941 1108	Direct Drive					No power at unit fan not running	
EF-W3,W4	G-060-D-X	12564940 1108	Direct Drive						
EF2			2-A41					Motor is defective and no power getting to unit. Due to age of motor if replaced, would have to remove motor and take to supplier to source for a new motor	
RTU			B36	(2) 16X25X1					
EF-W1	G-123-VG-5-X	12564937 1108	Direct Drive						
EF-G1	G-143-VG-7-X	12564935 1108	Direct Drive						
HRV	HRV2000E EDA1XG12DNHDBS	6K8220030901484	B36	(4) 12X24X4					