

HILLCREST

Equipment	Model/Serial	Location	What it Serves	Time Spent	Filters	Belts	Repairs Needed or Repaired
MUA	EngAir FWA285DG1800 / B39306HRU			60 min	(24of) 24x20x4 (6of) 20x20x4	(3of) B98 (1of) 3B124 (5of) B113	Greased Bearings on Supply Air Fan - (4of) door handles missing - Cleaned Condensate pans under Evaporator Coil - Greased Bearings on Exhaust Fan Motor, Pulleys worn and grooved s/b replaced Hub SK X 2 -7/16" - all gas piping could use touch up around threaded joints - Completed
RTU	Carrier 48VLB2404030 / 251C11495	Lower roof back of school		30 min	(2of) 12x24x1		
SP 1	Greenheck RSF10015X / 06E07637	Mechanical Room Ventilation		30 min	(4of) 12x24x?	(1of) AX39	Filters need to replaced - Completed
EF 6	Greenheck MN6B0816X / 06			20 min		(1of) 3L280	
EF 5	Greenheck 6B0816X / 06E08943			20 min		(1of) 3L210	
ERV 2	Carnes HRU WECC0318R2R2C1EE / 231331.002			60 min	(4of) 18x20x2	(1of) A50	Replaced belts site stock
HP 35	McQuay WMS1036FZ00200AA11Z2A2 / AUBU081601556	Room 221	Room 221	60 min			Unit in alarm - checked proper operation, checked compressor contactor, simulate call for cooling ok, clean evaporator pan - tightened all electrical connections unit is now operating

Administrative 20 min